

Manhole Inspection Summary

Manhole # S0100_023MH

Printed On: 6/24/2010

Page 1 of 3

Inspection ☐ Is Incomplete Rating: **4) Poor**

Record Plat: **0100** Node: **023** Status: **Found**

Insp Date: **2/5/08 1:42 PM**

Incomplete Comments

Crew: **RL CB**
Inspector: **Lamont**
Firm: **URS**

Location Address: **4511 PROSPECT CIR**

Cross Street: **PROSPECT CIR**

Manhole Type: **Inline** Location: **Easement / Right of Way**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

Cover Shape: **Circular** Diameter: **26** (in.) Length: (in.) Dist A/B Grade: **48** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **0** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment ☐ Exists Material: ☐ Parged Height: (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☐ Sound ☐ Cracked ☒ **Root Intrusion** ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☒ **Cracks** ☐ Mortar ☒ **Roots** ☐ Wall

Barrel Material: **Brick** ☐ Parged

Shape: **Circular** Diameter: **48** (in.) Length: (in.)

Condition: ☐ Sound ☐ Cracked ☒ **Root Intrusion** ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☒ **Cracks** ☐ Mortar ☒ **Roots** ☒ **Wall**

Bench ☒ Exists Material: **Brick** ☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel Material: **Brick** ☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps Count: **4** Missing: **0** ☐ Corroded

Surcharge ☒ **Evidence Of Surcharge** Depth: **5** (ft.) ☐ Active Surcharge Present

Location View



Top View




Defect 1




CORBEL ROOTS

Defect 3

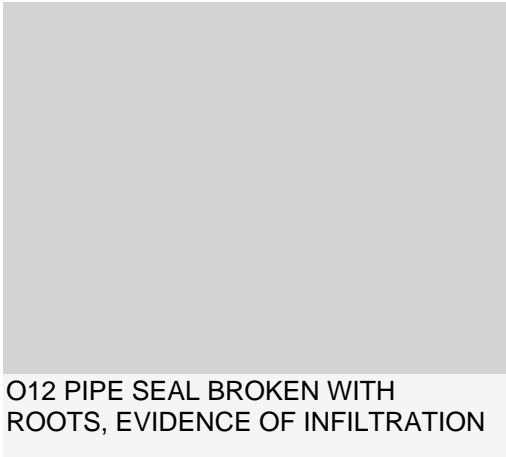

O12 PIPE SEAL BROKEN WITH
ROOTS, EVIDENCE OF INFILTRATION

Defect 2

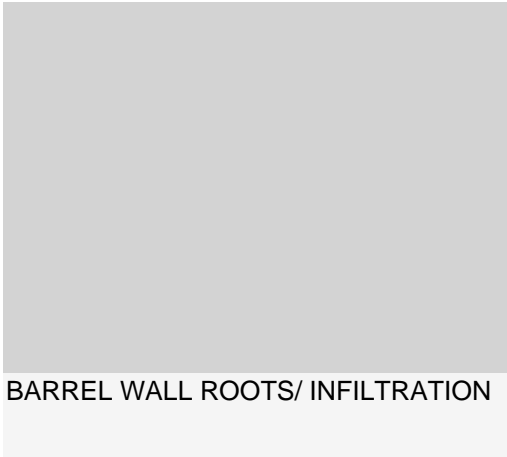

BARREL WALL ROOTS/ INFILTRATION

Manhole Inspection Summary

Manhole # S01OO_023MH

Printed On: 6/24/2010

Page 3 of 3

12 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



BROKEN PIPE SEAL

Pipe Height: **12** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **9.10** (ft.) Flow Characteristics: **Turbulent**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence** Pipe Seal Cond: **Broken**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

12 in. Circular Gravity Sewer
Pipe In @ 6 O'Clock

6 O'Clock Inflow



Pipe Height: **12** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **7.80** (ft.) Flow Characteristics: **Turbulent**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection